

HYDROGEOLOGIC AND GEOPHYSICAL ASSESSMENT OF GROUNDWATER PROSPECTS AND AQUIFER VULNERABILITY IN ALADE IDANRE, SOUTHWESTERN NIGERIA

ABSTRACT

Geophysical survey, involving Schlumberger depth soundings, were conducted at Alade, Ondo State, Nigeria. This was aimed at delineating the water supply areas and assessment of the vulnerability of the aquifers to contaminants infiltrating from the surface. The area is underlain by the basement complex rocks of Southwestern Nigeria. A total of 56 Schlumberger Vertical Electrical Soundings were carried out along the study area. The VES curves were preliminarily interpreted by partial curve matching. The interpretation results were refined with the WinRESIST software, and used to generate geoelectric sections and maps. The HA curves constitute the highest percentage of curves in the area. The geoelectric sections show three to four geoelectric layers which include topsoil, weathered layer and fresh basement. The topsoil varies between 0.4 and 3.6m, and the depths to the bedrock are generally less than 7.0 m. The thickness of the vadose zones across the area ranges between 1.4 and 6.0m. This shows that unconsolidated materials are generally not significantly thick and hence of apparently low groundwater prospect. The topsoil layer has a resistivity mostly within the range of 1 – 100 ohm-m across the area. Resistivity values within the bracket indicate clay sequence; this suggests that aquifers within the unconsolidated overburden at Alade Idanre are mostly capped by semi - pervious materials, geologically protecting the aquifer from near - surface contamination.

Keywords: Schlumberger, Aquifer, Groundwater, Vulnerability, Resistivity

INTRODUCTION

The availability of safe and potable water in an environment is a veritable index of a tremendous role to the development and growth of a community. Alade Idenre has witnessed an exponential increase in population of various groups of people in recent time; this development has impacted heavy demands on potable water for domestic uses. At present, groundwater through shallow hand dug well and few borehole constructions constitutes a major source of drinking water supply in this area. The yields are somewhat not enough for the populace and some hand dug well may be vulnerable to surface or near surface contamination. In order to ease the problem of water scarcity and improve the living standard of the community this study was initiated to investigate the hydrogeological characteristics/groundwater potentials and aquifer vulnerability in the area. Geophysical methods play increasingly important roles in locating suitable and

productive groundwater reservoirs. Electrical resistivity methods can be used for assessment of hydraulic conductivity of aquifer, transmissivity of aquifer, specific yield of aquifer and contamination of groundwater (Chudhury *et al.*, 2001).

These geological features deform the basement rock and enhance groundwater storage and movement (Olorunfemi *et al.*, 2004). Aquifers in basement complex terrain sometimes occur at shallow depths and such aquifer could be vulnerable to surface or near surface contamination (Omosuyi, 2010). Animal waste, septic tanks and buried waste at landfills all have the potential to contaminate infiltrating precipitation, and ultimately groundwater. Infiltrating precipitation moves through the vadose zone (the unsaturated material above the water table) and can transport virtually any compound that dissolves in it (chemicals that are improperly stored at the surface). The speed of groundwater movement is measured in feet per year (Moore, 2010); this is why contaminants that enter groundwater require many years before they are filtered out. The size of the spaces in the soil or rock and how well the spaces are connected determined the speed at which groundwater flows. Contamination usually reduces the electrical resistivity of pure water due to increase in ionic concentration (Fronlich *et al.*, 2002). Alade lies within the precambrian basement complex terrain of southwestern Nigeria (Rahaman, 1976).

LOCATION AND GEOLOGY OF THE STUDY AREA

Alade Idanre is located at the central Senatorial district of Ondo State. Alade lies within latitudes $6^{\circ}37'37.55''\text{N}$ to $7^{\circ}8'24.78''\text{N}$ and longitudes $5^{\circ}5'43.38''\text{E}$ to $5^{\circ}37'55.58''\text{E}$ (Fig. 1). The study area falls within the basement complex of southwestern Nigeria and its surface topography can be described as highly undulating with high gradients. Parts of the study area have high rising mountain ranges with topographical elevation ranging from 274 to 304m. The area experiences two major season; the rainy season which is usually between April to October and dry season between November to March, the annual rainfall ranges between 1250mm to 2500mm [Duze and Ojo, 1982]. The area is situated in the rainforest type of vegetation and characterized by dense evergreen forest; the thick vegetation, farming, forest exploration and other main activities have affected the natural vegetation.

Alade area is underlain by the Precambrian basement complex of southwestern Nigeria (Ajibade and fitches 1988). Rahaman, 1988, identified six major petrologic units. Mineralogically, the granite gneisses around Alade area composed of alkaline feldspar, quartz, plagioclase and biotite (Ocan, 1991). The structures observed on the outcrops in the study area are faults and Dykes structures. Generally, in a typical basement complex area, groundwater is usually contained in the weathered column and fractured, sheared or jointed/faulted basement column. These geological processes alter rock units to reduce resistivity and hence increase the porosity and permeability of such units for groundwater accumulation.

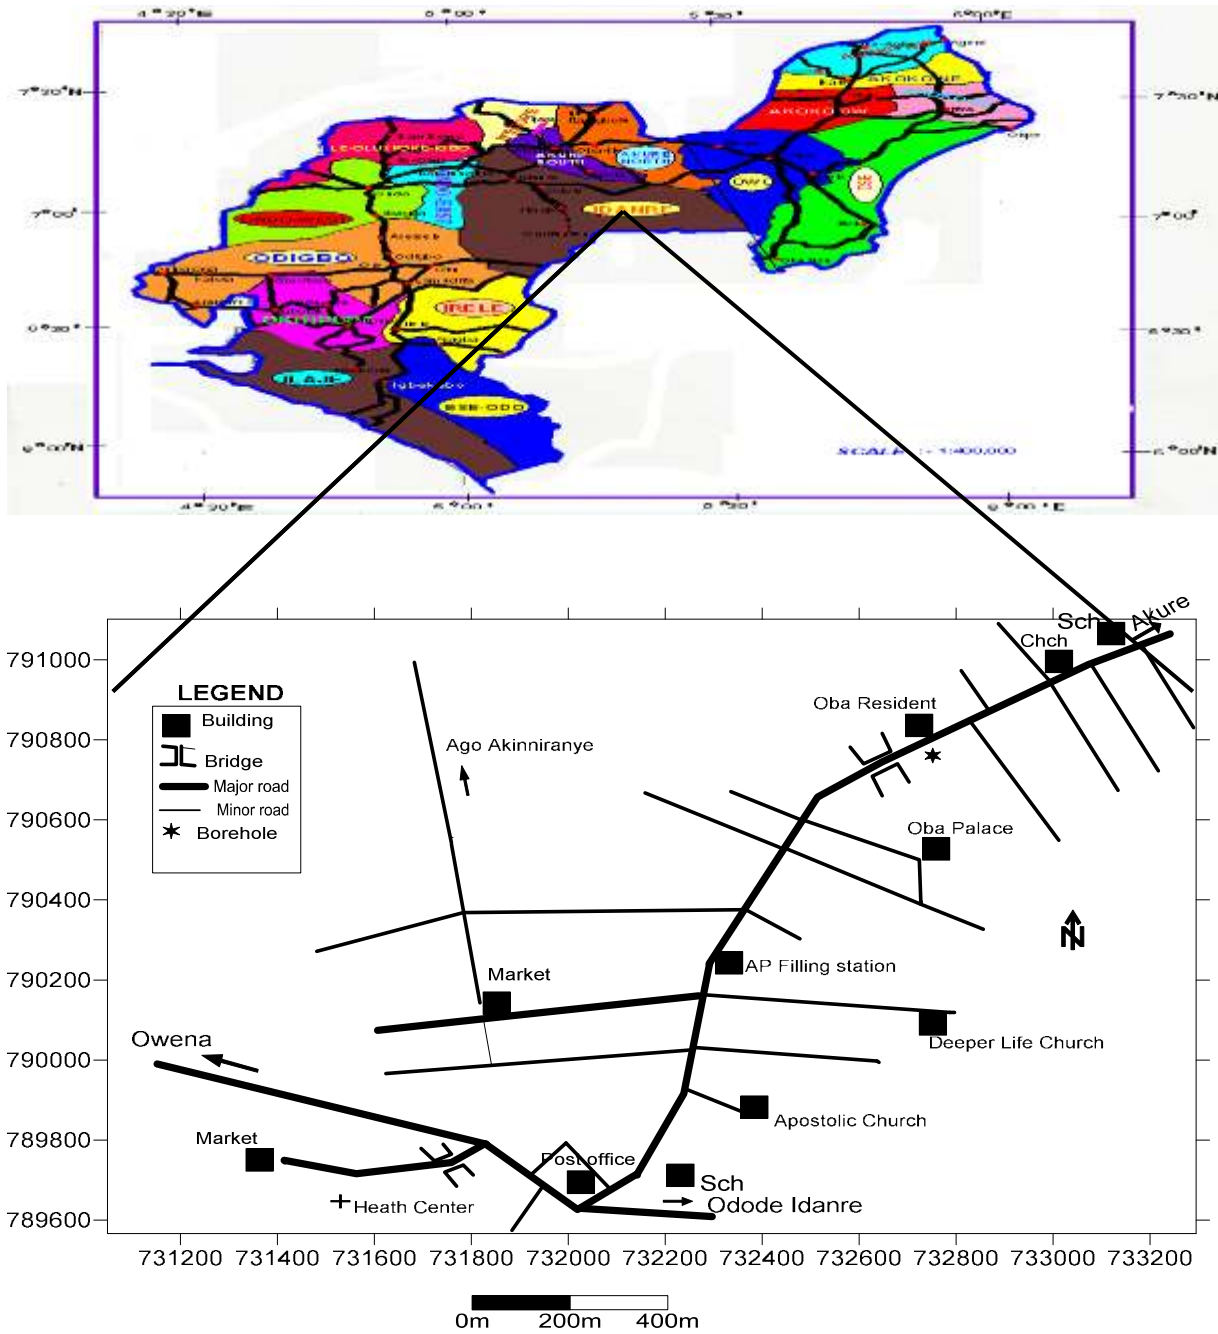


Fig. 1: Location Map of the Study Area (Insert: Map of Ondo State Showing the Study Area)

METHODOLOGY

GEOPHYSICAL SURVEY

Schlumberger electrical resistivity method (ERM) was utilized in this work, The instrument used are cable, steel electrodes, hammers, ABEM SAS 1000 Terrameter, D.C battery, G.P.S, measuring tapes. It involved moving the current electrodes and having the potential electrodes fixed with reference to the center point. Sixty electrical soundings were carried out in the study area with maximum current electrode spacing (AB) = 130m, (AB/2) = 65m on each VES points. Vertical electrical soundings (VES) were performed continuously and the resistivity along a profile were measured.

The data obtained were plotted on a bi-log graph and the best smooth curve taken through the set of data from the traditional method using master curves and auxiliary charts (Orellana and Mooney1966). The VES data were refined by computer iteration technique as curves, on plots of apparent resistivity against electrode spread (AB/2) on a bilog-paper (Vander Velpen, 1988). The model signature indicates low and high resistivity in the different layers encountered. This method was interpreted qualitatively and quantitatively. Qualitative interpretation involves inspection of profiles, maps and pseudo-sections for anomaly patterns that are characteristics of a particular target. Quantitative interpretation involves partial curve matching techniques which require model curves (Koefoed, 1979).

Static Water Level Determination.

With the aid of meter rule and tape, the depth to the water levels and total depth in the hand-dug wells within Alade were measured and recorded. The global positioning system (GPS) was used to measure the longitude, latitude and the surface elevation with respect to the mean sea level at point within Alade. The mean sea level is the lowest surface within the earth

Forty two hand dug wells were logged to reveal estimation of depth to the water level, depth to the bedrock and water table elevation. The surface elevation at different points vary due to topographic variation, the true water level were obtained by subtracting the measured depth to the water level in the hand-dug wells from the surface elevation to get uniform water levels otherwise known as the elevation of the water level (Buddermier and Schloss, 2000).

HYDRO-GEOLOGICAL MEASUREMENTS

Measurements were done from hand dug well to reveal the depth of unsaturated zone (Vadose zone) and the water column.

RESULTS AND DISCUSSIONS

The geo-electric section displays mostly three distinct geo-electric layers which is defined by topsoil comprising of clay/sandy, clay/laterite, (thickness ranging from 0.4-4.0m and resistivity

value between 29 and 854ohm-m), weathered layer (thickness ranges from 0.3-14m, resistivity value between 3.4 and 489ohm-m) and partially weathered/fresh bedrock (resistivity value between 470 and 8843ohm-m). The groundwater flow direction is towards the southern part of the area. Geo-electric section along E-W in the study area revealed thick weathered layers at VES 16, 36, and 40 indicating good aquiferous units for groundwater prospects. The geo-electric section revealed thick overburden zones beneath VES 5, 11, 32 and 41 indicating good aquiferous units for groundwater prospects.

Table 1: Summary of VES Results from the Study Area.

S/N (VES)	Layers	Resistivity (ohm-m) $\rho_1/\rho_2...\rho_{n-1}$	Thickness(m) $t_1/t_2/....t_{n-1}/t_n$	depth(m) $d_1/d_2/....d_{n-1}/d_n$	Curve type
1	4	98.6/75.8/53.4/486.4	1.1/0.5/2.8	1.1/1.6/4.4	HA
2	5	74.3/153.9/1705.7/1820.6/705.9	0.6/0.6/1.6/3.4	0.6/1.2/2.8/6.2	A
3	4	232.5/1472/2395.3/4470.3	0.6/0.8/3.4	0.6/1.4/4.9	A
4	5	146.3/100.5/83/1356.9/1130.8	1/0.5/2.1/5.2	1/1.5/3.6/8.3	HA
5	3	164.4/466.9/3090	0.8/5.6	0.8/6.4	A
6	4	115/61.6/52.6/1522.3	0.9/0.4/1.8	0.9/1.4/3.2	HA
7	4	55/34.5/23/2348.3	0.9/0.6/2.3	0.9/1.4/3.7	HA
8	4	33.5/21.8/14.9/1296	1/0.5/2.4	1/1.6/4	HA
9	4	29.4/28/22.7/1429.7	1.2/0.6/2.1	1.2/1.7/3.8	HA
10	3	52.7/32.5/1659.1	1.4/1.1	1.4/2.6	HA
11	4	210.4/102.1/40.4/587.5	1.1/0.8/4.6	1.1/1.9/6.4	HA
12	3	99/49.9/753.8	3.6/1.7	3.6/5.4	HA
13	4	56/32.9/37.8/1936.6	1/0.5/1.7	1/1.4/3.2	HA
14	4	55.1/28.3/26.5/1568.8	0.8/0.6/1.6	0.8/1.4/3	HA
15	4	72.9/69.1/31.9/3692.6	1.1/1/4.6	1.1/2/1/6.7	HA


16	4	88.5/166.6/77.1/2361.1	1.6/1.1/6.6	1.6/2.7/9.4	KHA
17	4	59.4/251.4/38.7/834.6	0.8/1.3/4.4	0.9/2.1/6.5	KHA
18	4	93.5/59.6/38.7/3163.1	1/0.5/3.4	1/1.5/4.9	HA
19	4	44.9/14.5/219.6/4543.2	0.9/1/2.5	0.9/1.9/4.4	HA
20	4	59.4/3.4/292.3/3434.3	1.1/0.3/1.6	1.1/1.5/3	HA
21	5	677/149.1/116.3/47.6/1417.3	0.7/0.4/1/5.7	0.7/1.1/2.1/7.8	KHA
22	3	38.8/39.2/2455.6	1/2.8	1/3.8	A
23	4	217.2/16.8/38.8/1009.1	0.4/0.5/3.4	0.4/0.9/4.3	HA
24	4	96/72.1/252/4211.2	0.9/3.4/2.4	0.9/4.3/6.7	HA
25	5	42.8/110.4/64.1/32.3/1908.2	0.7/0.6/1.7/4	0.7/1.2/2.9/6.9	KHA
26	4	280.7/128.2/17.3/909	1.5/0.6/3.7	1.5/2.1/5.8	HA
27	4	187.8/82.8/43.4/613.4	0.8/0.5/4.1	0.8/1.2/5.3	HA
28	4	145.8/54/35/913	0.6/0.4/2	0.6/1/3	HA
29	5	552.9/252.8/355.2/708.5/790.2	0.7/0.4/1/9	0.7/1.1/2.1/11	HA
30	4	217.8/79.3/119.5/944.2	0.7/0.9/2.6	0.7/1.7/4.2	HA
31	4	127.8/30.4/60.6/6140.2	1.2/1.4/1.9	1.2/2.6/4.4	HA
32	4	464.7/137.1/126/661	0.7/1.6/11	0.7/2.3/13.3	HA
33	3	79.8/488.5/6643.5	0.5/9	0.5/9.5	A
34	4	182.9/65/90.6/8843	0.7/1/3.7	0.7/1.6/5.3	HA
35	4	333.5/74.2/54.8/3587	1/1.3/4.9	1/2.4/7.3	HA
36	4	91/39.5/41.4/906.2	0.5/0.9/4.8	0.5/1.4/6.2	HA
37	4	71.1/18.4/45.9/1342	0.7/0.9/1.8	0.7/1.6/3.4	HA
38	4	67.8/11.8/21.4/2142.3	0.8/1.1/2	0.8/1.9/3.9	HA
39	4	368/74.1/35.9/3938.4	0.8/0.6/2.4	0.8/1.4/3.8	HA

40	4	176.6/39.6/55.4/469.5	0.9/1.5/3.6	0.9/2.5/6.1	HA
41	5	150.8/199.2/100.7/111.4/1722	0.9/0.8/1.9/4.3	0.9/1.7/3.6/8	KHA
42	4	853.5/119.9/131.7/1396	0.7/1.1/4.1	0.7/1.8/5.9	HA
43	4	461.7/70.1/74.3/5349.4	0.4/2.2/4.2	0.4/2.5/6.7	HA
44	4	68.8/86.2/82.3/3130.2	0.9/2.5/3.2	0.9/3.4/6.6	A
45	5	386.8/176/287/317.5/2751.2	0.8/1/4.6/11.2	0.8/1.8/6.4/17.6	HA
46	4	408/58.3/31.9/5685.1	0.6/0.9/3	0.6/1.4/4.5	HA
47	5	383.8/47.9/86.2/134.9/1246.2	0.5/1/2.5/13.7	0.6/1.6/4/17.7	HA
48	4	270.6/56.9/45.4/2449.5	0.5/1.1/5.7	0.5/1.6/7.3	HA
49	4	659.3/177.6/73.5/3252.5	1.3/1.2/4.8	1.3/2.5/7.3	HA
50	5	164.8/228.5/164.1/280.9/3095.8	0.9/0.8/1.8/3.3	0.9/1.7/3.5/6.8	A
51	4	313.4/496.1/377.2/2604	1/1.6/4.7	1/2.6/7.4	A
52	4	163.7/4637.7/1099.3/3034.8	0.6/3.1/6.8	0.6/3.7/10.5	A
53	3	72.3/57/705.4	3.9/3.6	3.9/7.5	HA
54	5	130.2/188.7/22.7/77.3/4067.7	0.8/0.8/2/2.4	0.8/1.5/3.5/5.9	KHA
55	4	627.9/201.8/79.7/2713.2	0.7/2.1/7.3	0.7/2.8/10	H
56	4	234.3/98.2/163.7/868.6	1.5/2.7/6.1	1.5/4.2/10.3	HA


127

128

Fig.2: Typical Vertical Electrical Sounding Curves from the Study Area

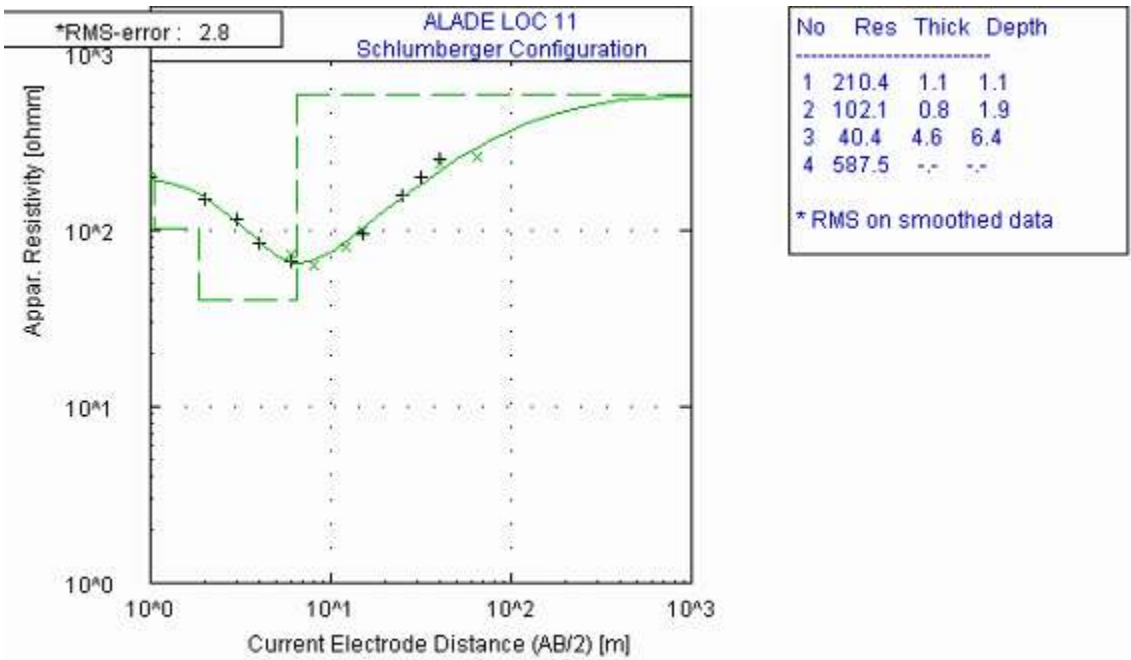


B: KHA Curve type

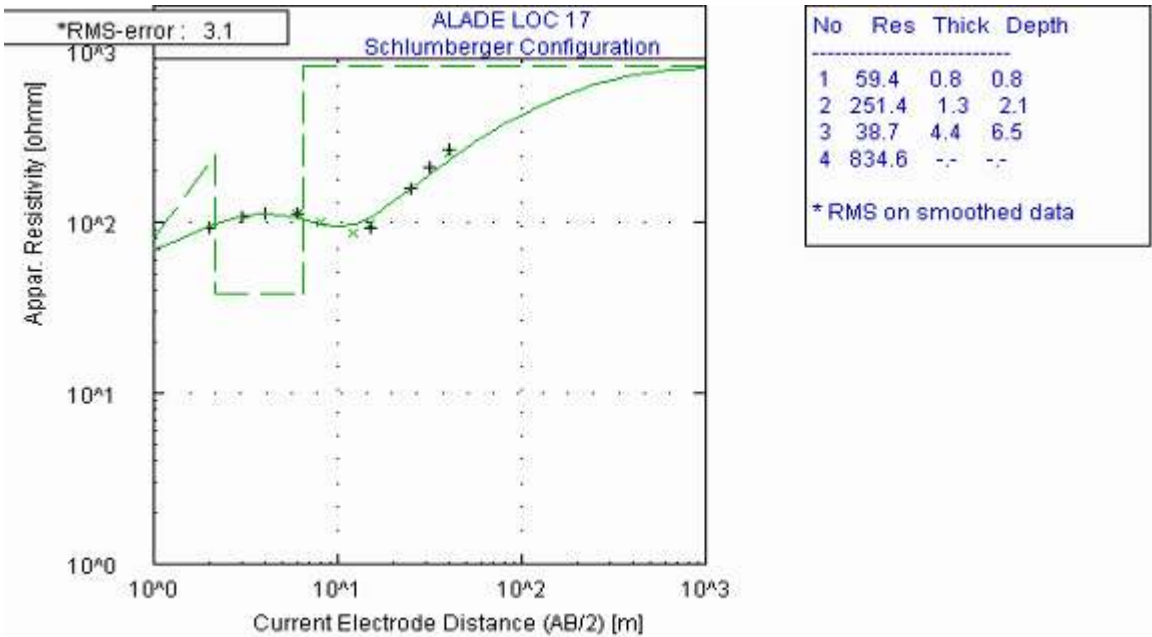

C: A Curve type

135

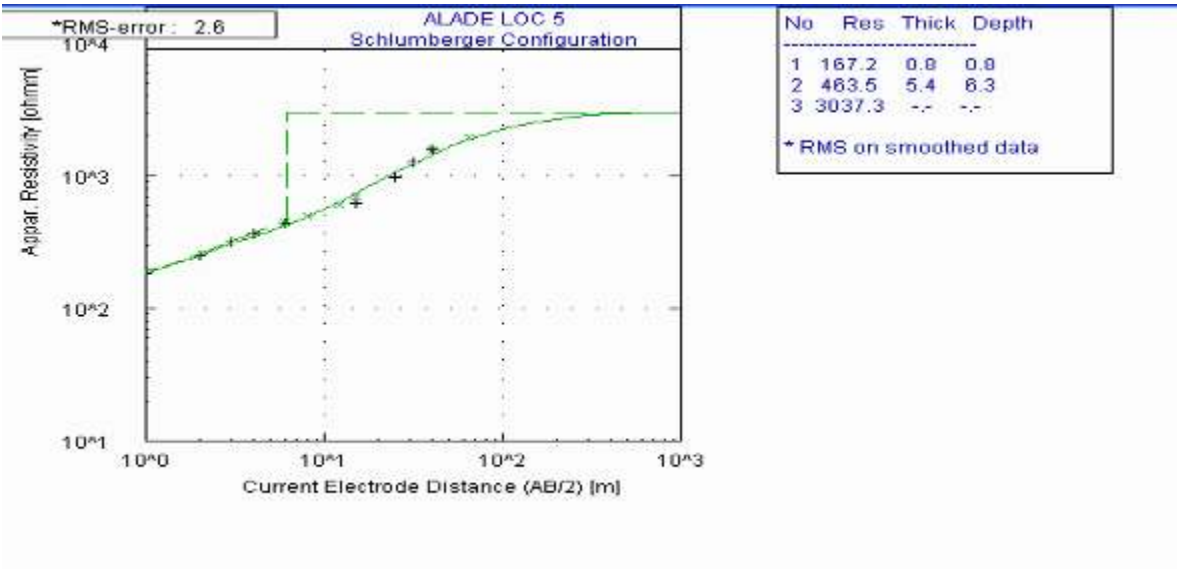


136

137

138 D: H Curve type

139

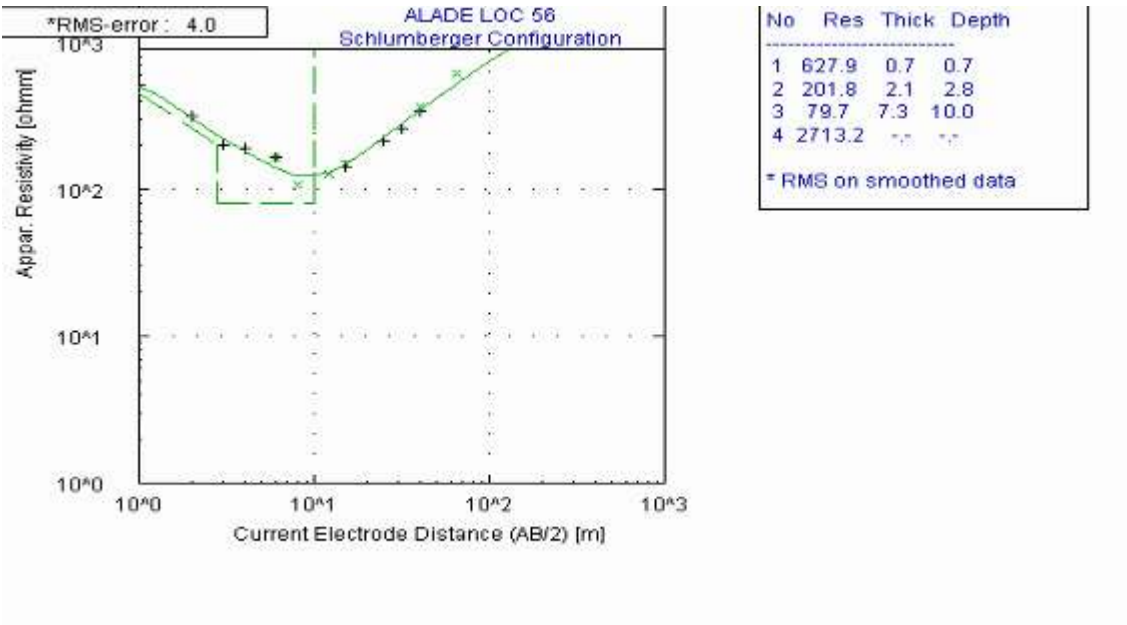

140

141

142

143

Fig.3a: Geo-electric section along E-W direction and fig.3b: Geo-electric section along W-E direction

Fig.3a


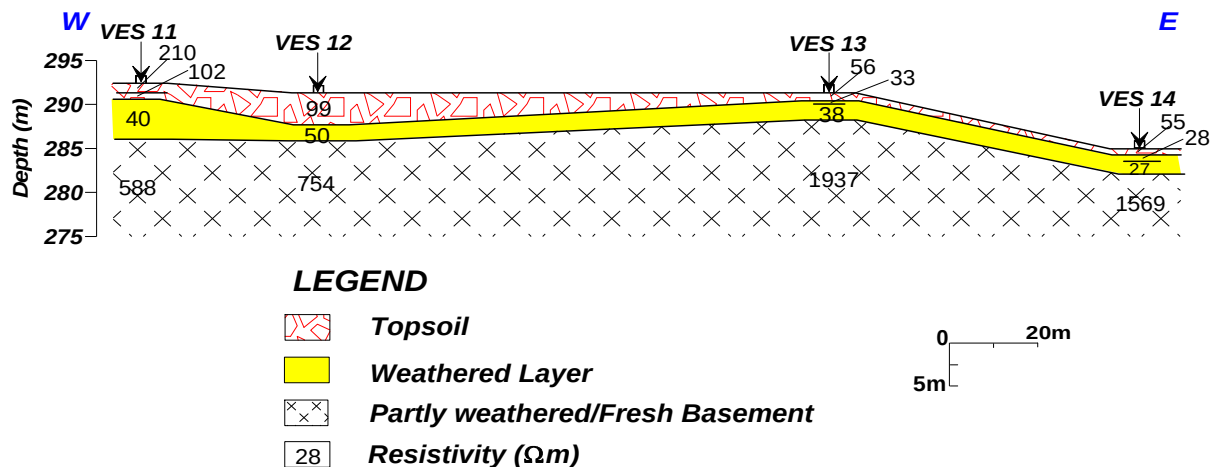


Fig.3b

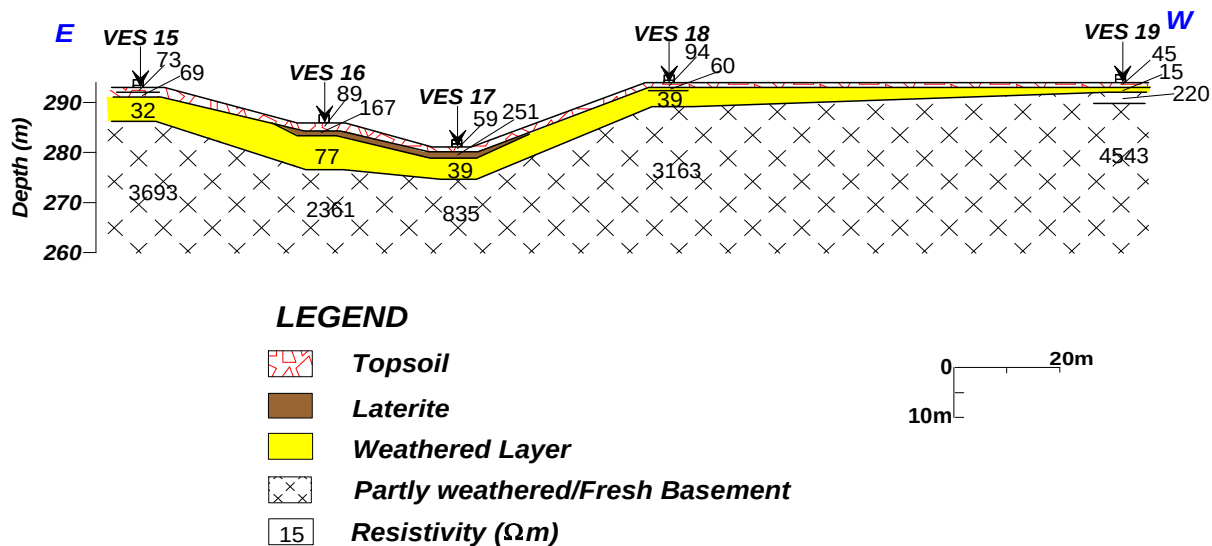

Aquifer Vulnerability Study

Aquifers in crystalline basement terrains are often exposed to environmental risks, due to shallow depth of occurrence. The resistivity parameter of the topsoil geoelectric layer in the study area was used to assess the vulnerability of the underlying aquifer. Fig.5 is a contour map

of resistivity of the layers. About 70% of the resistivity values of the topsoil layer fall within 1 – 100 ohm-m range. In Nigeria, geologically this suggests clayey or silt sequence, which can constitute impervious/semi-impervious barriers.

The unsaturated zone (Vadose) is the geologic materials between the earth's surface and the water table and can also be referred to as zone of aeration. The thickness of this zone determines the transit time, therefore the thicker the vadose zone, the lesser the groundwater vulnerability to contaminants. The contour map (fig.5) shows the thickness of the vadose zones in the study area.

Longitudinal unit conductance (S) was used to determine how aquifers are being protected from any infiltrating contaminants. The study revealed that, the higher the value of (S), the more protected the aquifer is (Tab. 3). Therefore the aquifers at the central flank/Northeastern part of the study area are more protected and not vulnerable to contaminants.

Aquifer

The weathered unit constitutes the aquifer in the study area. The weathered layer resistivity map (fig.5) shows resistivity distribution ranging from about 33-900ohm-m. Low resistivity values (below 100) were observed in the central and part of the northeastern location which may be indicative of clayey materials. Also, it was observed that there are moderately weathered zones characterized with resistivity range of 100ohm-m and 450ohm-m. These zones are associated with good groundwater prospects (Omosuyi etal, 2008). In the absence of the fractured bedrock with resistivity range of 500-900 Ohm-m, the weathered layer is not expected to produce sufficient groundwater.

Hydro-geological measurements

Tab. 2: Field Data Acquired for the Static Water Level and Elevations within the Study Area.

Well No	Latitude (Degree, Min, Sec)	Longitude (Degree, Min, Sec)	Elevation (m)	Depth to Water Level (m)	Total Depth(m)	Water column	Static Water Level
1	07 ⁰ 08' 59.5"	005 ⁰ 06' 44.9"	293	1.48	3.20	1.72	291.5
2	07 ⁰ 08' 59.1"	005 ⁰ 06' 42.2"	294	5.00	5.40	0.40	289.1
3	07 ⁰ 08' 59.0"	005 ⁰ 06' 42.2"	297	4.90	5.00	0.10	292.1
4	07 ⁰ 09' 01.2"	005 ⁰ 06' 40.2"	293	6.00	6.07	0.07	287.0
5	07 ⁰ 09' 02.6"	005 ⁰ 06' 37.7"	298	4.70	6.20	1.50	293.3

6	07 ⁰ 09' 02.2"	005 ⁰ 06' 35.5"	293	1.50	2.60	1.10	291.5
7	07 ⁰ 09' 00.4"	005 ⁰ 06' 34.7"	292	2.06	3.33	1.27	289.9
8	07 ⁰ 09' 02.0"	005 ⁰ 06' 34.5"	298	3.00	4.40	1.40	295.0
9	07 ⁰ 09' 03.6"	005 ⁰ 06' 35.8"	297	3.28	4.65	1.37	293.7
10	07 ⁰ 09' 07.5"	005 ⁰ 06' 32.2"	306	4.68	5.10	0.42	301.3
11	07 ⁰ 09' 04.8"	005 ⁰ 06' 27.3"	305	3.20	4.85	1.65	301.8
12	07 ⁰ 09' 02.8"	005 ⁰ 06' 29.6"	295	3.00	3.80	0.80	292.0
13	07 ⁰ 09' 02.7"	005 ⁰ 06' 31.2"	306	3.30	4.50	1.20	302.7
14	07 ⁰ 09' 00.6"	005 ⁰ 06' 30.6"	297	3.40	3.80	0.40	293.6
15	07 ⁰ 08' 58.7"	005 ⁰ 06' 30.7"	295	3.50	3.60	0.10	291.5
16	07 ⁰ 08' 59.0"	005 ⁰ 06' 32.1"	301	3.60	3.80	0.20	297.4
17	07 ⁰ 08' 58.5"	005 ⁰ 06' 31.0"	297	3.70	4.00	0.30	293.3
18	07 ⁰ 08' 59.4"	005 ⁰ 06' 24.8"	291	2.30	3.80	0.50	288.9
19	07 ⁰ 09' 04.5"	005 ⁰ 06' 24.2"	293	2.60	3.80	1.20	290.4
20	07 ⁰ 08' 57.9"	005 ⁰ 06' 21.1"	292	2.20	3.40	1.20	289.8
21	07 ⁰ 08' 56.5"	005 ⁰ 06' 17.5"	292	5.10	5.60	0.50	286.9
22	06 ⁰ 37' 15.6"	005 ⁰ 37' 39.6"	297	3.60	4.50	0.90	293.4
23	06 ⁰ 37' 15.6"	005 ⁰ 37' 38.8"	298	3.80	4.30	0.50	294.2
24	06 ⁰ 37' 9.5"	005 ⁰ 37' 34.4"	301	4.10	5.20	1.10	296.9
25	06 ⁰ 37' 12.0"	005 ⁰ 37' 31.6"	290	4.50	5.40	0.90	285.5
26	06 ⁰ 37' 7.5"	005 ⁰ 37' 34.8"	302	3.20	4.10	0.90	297.9
27	06 ⁰ 37' 5.3"	005 ⁰ 37' 34.1"	294	3.80	4.90	1.10	290.2
28	06 ⁰ 37' 2.0"	005 ⁰ 37' 33.8"	291	4.20	5.10	0.90	286.8
29	06 ⁰ 37' 0.7"	005 ⁰ 37' 33.7"	300	4.20	5.30	1.10	295.8

30	06 ⁰ 36' 57.8"	005 ⁰ 37' 31.8"	307	4.90	5.70	0.80	302.1
31	06 ⁰ 36' 59.0"	005 ⁰ 37' 31.4"	302	2.80	3.90	1.10	299.2
32	06 ⁰ 36' 54.4"	005 ⁰ 37' 25.0"	305	3.00	3.70	0.70	302.0
33	06 ⁰ 36' 55.1"	005 ⁰ 37' 25.2"	295	3.10	4.50	1.40	291.9
34	06 ⁰ 36' 56.8"	005 ⁰ 37' 25.4"	308	3.90	4.80	0.90	304.1
35	06 ⁰ 37' 1.0"	005 ⁰ 37' 26.4"	304	4.10	5.10	1.00	299.9
36	06 ⁰ 37' 3.4"	005 ⁰ 37' 26.8"	286	3.00	4.10	1.10	283.0
37	006 ⁰ 37' 3.6"	005 ⁰ 37' 26.3"	277	3.20	4.50	1.30	273.8
38	06 ⁰ 37' 4.7"	005 ⁰ 37' 26.7"	292	3.30	4.20	0.90	288.7
39	06 ⁰ 37' 9.6"	005 ⁰ 37' 25.8"	294	3.60	4.80	1.20	290.4
40	06 ⁰ 37' 12.1"	005 ⁰ 37' 26.1"	302	4.40	6.10	1.70	297.6
41	06 ⁰ 37' 14.4"	005 ⁰ 37' 26.0"	301	4.60	6.30	1.70	296.4

179

180

181

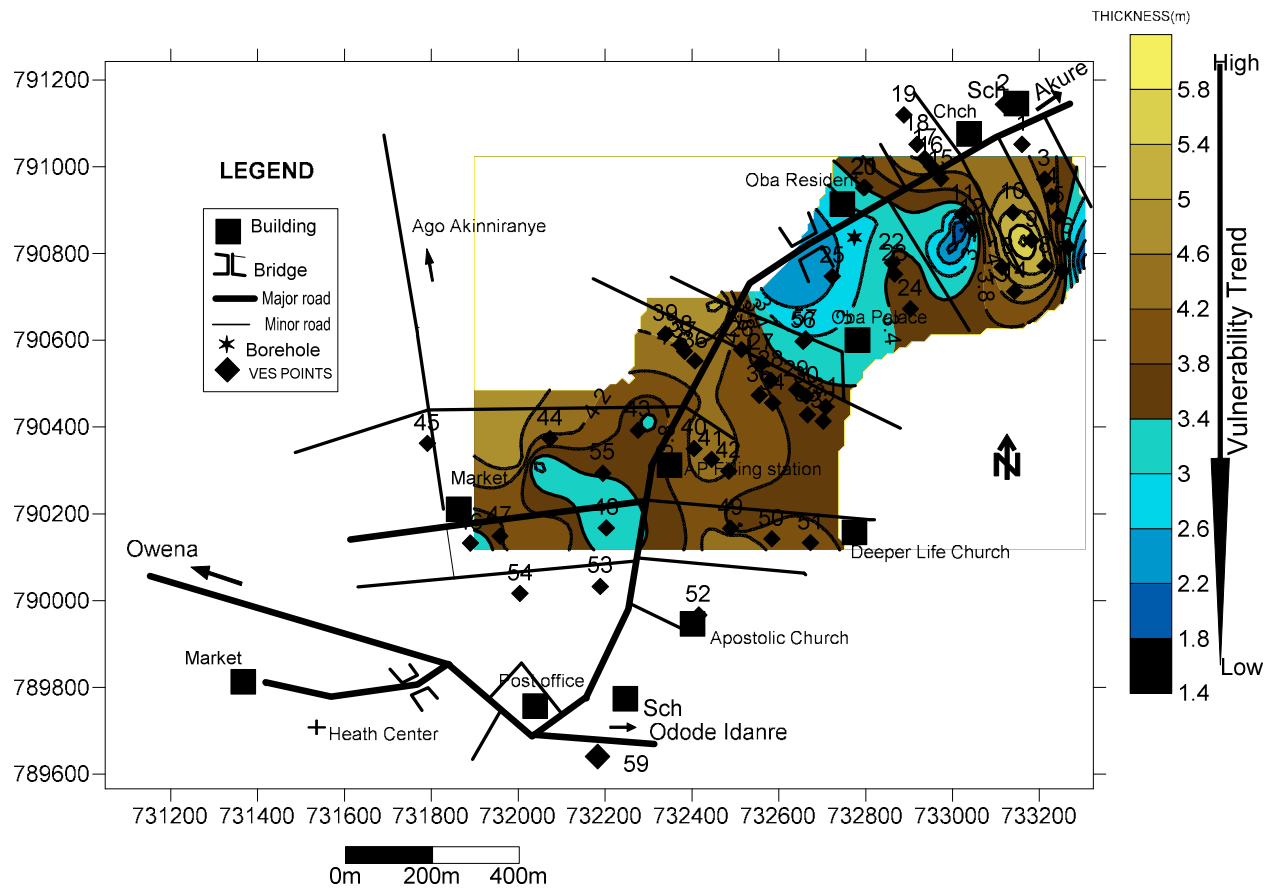


Fig. 4: Thickness Map showing unconsolidated materials overlying the basement at Alade.

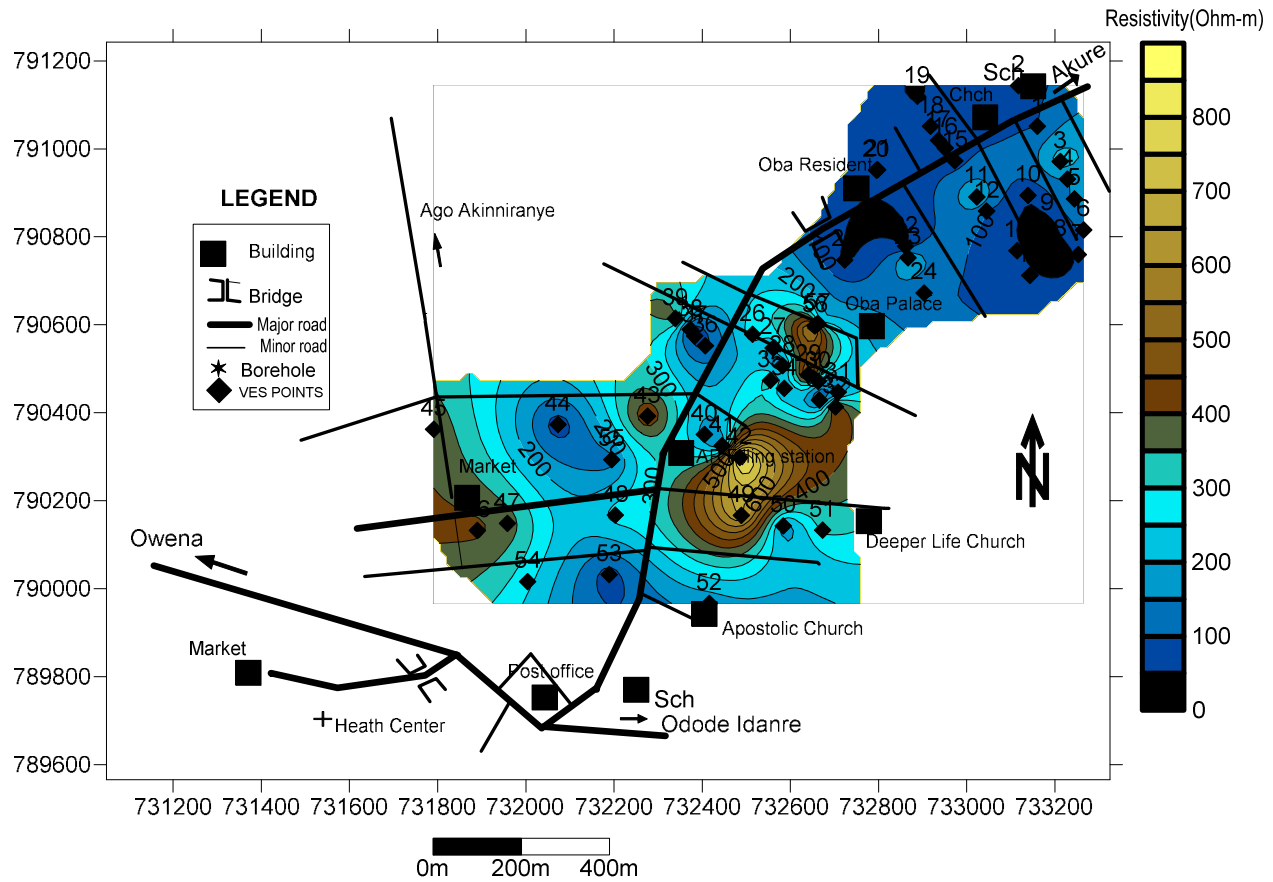


Fig. 5: Contour Map showing the resistivity distribution of the Aquifer Units

Table 3: Longitudinal conductance on each VES Point

Latitude	Longitude	VES Point	Longitudinal Conductance
07 ⁰ 09'08.4"N	005 ⁰ 06'40.2"E	1	0.0177
07 ⁰ 09'04.5"N	005 ⁰ 06'42.4"E	2	0.0118
07 ⁰ 09'00.7"N	005 ⁰ 06'43.6"E	3	0.0143
07 ⁰ 08'58.9"N	005 ⁰ 06'43.2"E	4	0.0335
07 ⁰ 08'59.3"N	005 ⁰ 06'41.9"E	5	0.0521

07 ⁰ 09'01.2"N	005 ⁰ 06'40.9"E	6	0.0522
07 ⁰ 09'03.3"N	005 ⁰ 06'39.5"E	7	0.0264
07 ⁰ 09'03.2"N	005 ⁰ 06'35.7"E	8	0.0130
07 ⁰ 09'02.2"N	005 ⁰ 06'36.4"E	9	0.0404
07 ⁰ 08'59.2"N	005 ⁰ 06'38.7"E	10	0.0179
07 ⁰ 08'57.4"N	005 ⁰ 06'39.6"E	11	0.0357
07 ⁰ 09'05.9"N	005 ⁰ 06'34.1"E	12	0.0296
07 ⁰ 09'06.8"N	005 ⁰ 06'33.4"E	13	0.0246
07 ⁰ 09'07.4"N	005 ⁰ 06'32.9"E	14	0.0187
07 ⁰ 09'08.5"N	005 ⁰ 06'32.3"E	15	0.0189
07 ⁰ 09'10.7"N	005 ⁰ 06'31.4"E	16	0.0200
07 ⁰ 09'02.5"N	005 ⁰ 06'30.2"E	17	0.0003
07 ⁰ 09'05.3"N	005 ⁰ 06'28.4"E	18	0.0216
07 ⁰ 08'58.7"N	005 ⁰ 06'30.6"E	19	0.0018
07 ⁰ 08'56.1"N	005 ⁰ 06'31.8"E	20	0.0094
07 ⁰ 08'58.6"N	005 ⁰ 06'25.9"E	21	0.0483
07 ⁰ 08'53.1"N	005 ⁰ 06'19.1"E	22	0.0100
07 ⁰ 08'52.1"N	005 ⁰ 06'20.6"E	23	0.0100
07 ⁰ 08'50.8"N	005 ⁰ 06'21.3"E	24	0.0120
07 ⁰ 08'50.1"N	005 ⁰ 06'40.7"E	25	0.0013
07 ⁰ 08'49.6"N	005 ⁰ 06'24.4"E	26	0.0022
07 ⁰ 08'48.8"N	005 ⁰ 06'25.4"E	27	0.0090
07 ⁰ 08'47.7"N	005 ⁰ 06'25.2"E	28	0.0132
07 ⁰ 08'49.1"N	005 ⁰ 06'21.4"E	29	0.0038

07°08'49.7"N	005°06'20.4"E	30	0.0205
07°08'52.3"N	005°06'15.6"E	31	0.0055
07°08'53.0"N	005°06'14.8"E	32	0.0098
07°08'53.5"N	005°06'14.5"E	33	0.1035
07°08'54.3"N	005°06'13.4"E	34	0.0103
07°08'45.7"N	005°06'15.5"E	35	0.0051
07°08'44.9"N	005°06'16.8"E	36	0.0100
07°08'44.0"N	005°06'18.1"E	37	0.0018
07°08'47.1"N	005°06'11.3"E	38	0.0009
07°08'46.5"N	005°06'04.7"E	39	0.0420
07°08'46.2"N	005°06'55.5"E	40	0.0021
07°08'38.7"N	005°06'58.7"E	41	0.0169
07°08'39.2"N	005°06'00.9"E	42	0.0013
07°08'39.8"N	005°06'08.9"E	43	0.0212
07°08'39.7"N	005°06'18.2"E	44	0.0087
07°08'38.9"N	005°06'21.3"E	45	0.0090
07°08'38.6"N	005°06'24.2"E	46	0.0064
07°08'35.4"N	005°06'08.4"E	47	0.0539
07°08'43.9"N	005°06'08.6"E	48	0.0103
07°08'34.9"N	005°06'02.4"E	49	0.0116
07°08'33.2"N	005°06'15.8"E	50	0.0064

193

194

195

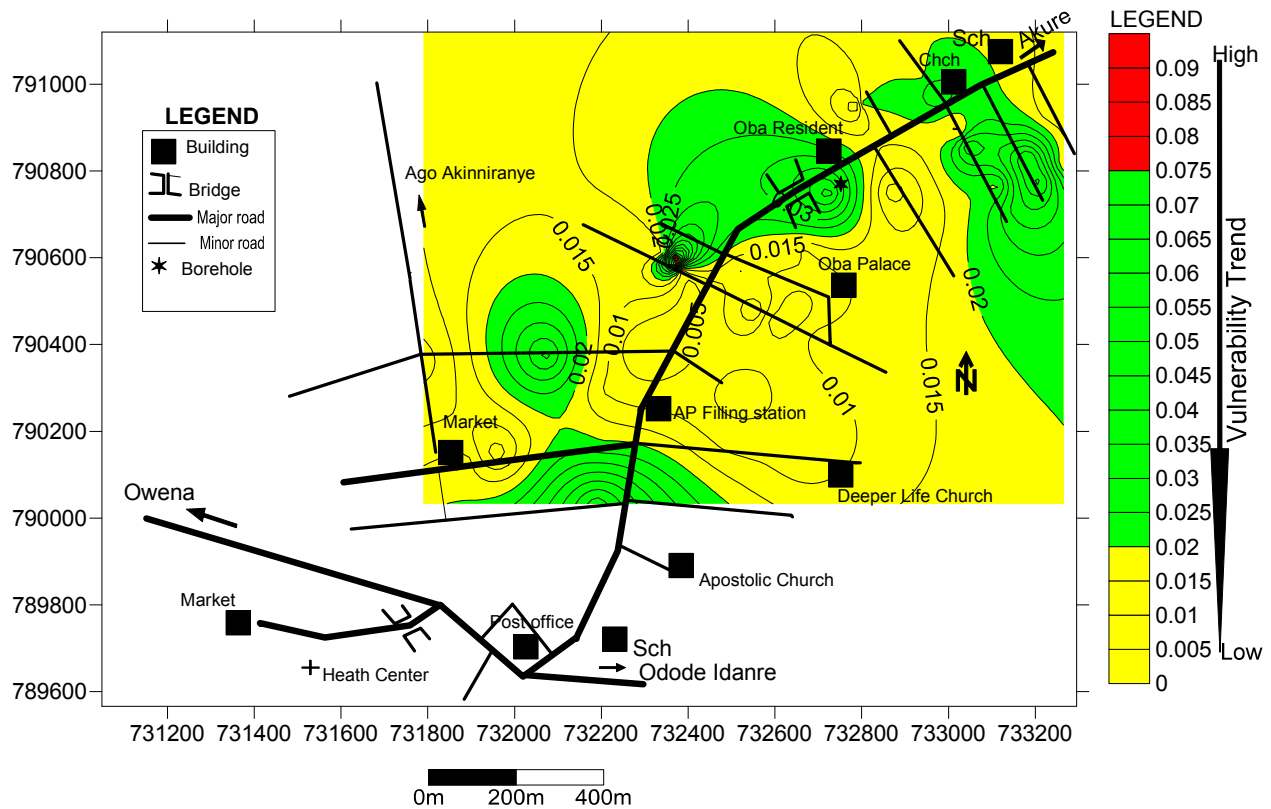


Fig. 6: Thickness Map showing Longitudinal Conductance from the study area

CONCLUSIONS

The VES results revealed that the topsoil is covered by almost 70% of clayey material. The unconsolidated layer and the weathered bedrock constitute the aquifer units in the study area. With reference to hydrological measurement of the existing wells, groundwater flow direction is towards Southern part of the area. It is also observed that considering the impermeability of the clayey topsoil which serves as the aquifer protector, the aquifer units in the study area are less vulnerable to contamination. The geo-electric sections delineated three to four subsurface geo-electric layers which include topsoil, weathered, and partially weathered/Fresh bedrock. The topsoil comprises of clay/sandy clay/laterite with thickness ranges from 0.4-3.6m and resistivity values between 29 and 854 Ohm-m, while the weathered layer thickness range from 0.3-13.7m, with resistivity value ranging between 30 and 489 Ohm-m. The partially weathered/fresh bedrock resistivity values ranges between 470 and 8843 Ohm-m, this indicate that the unconsolidated material in the study area is not significantly thick, thus suggesting that the groundwater potential in Alade is rating low. From the general results obtained, the study revealed that the water supply units in Alade are rated low to contamination.

- 216 **Ajide, A.C and Fitches, W.R (1988):** The Nigeria Precambrian and the Pan African Orogeny.
 217 In Precambrian Geology of Nigeria. A publication of the Geological Survey of Nigeria pp329.
- 218 **Buddemeier, R. W. and Schloss, J. A. (2000):** Groundwater Storage and flow.”[http://www.kgs.](http://www.kgs.Ukans.edu/Hight%20plains/atlas//apngngw.htm)
 219 [Ukans.edu/Hight plains/atlas//apngngw.htm](http://www.kgs.Ukans.edu/Hight%20plains/atlas//apngngw.htm).
- 220 **Chudhury, K., D.K Saha and P. Chakraborty, (2001):** Geophysical Study for Saline Water
 221 intrusion in a costal alluvial terrain. Journal Appl. Geophysics, 46: 189-200.
- 222 **Fronlich, R.K. and D. Urish, (2002):** The use of geoelectric and test wells for the assessment of
 223 groundwater quality of a coastal industrial site. Journal Appl. Geophysics, 50: 261-378.
- 224 **Fraser, (1969):** Contouring of VLF-EM data, Geophysics, Vol. 34, no 6, pp. 958-967.s
- 225 **Moore (2010):** A Guide for Site Investigation and Report Preparation. In Field Hydrogeology,
 226 CRC Press, pp1-8
- 227 **Koefeod, O. (1979):** Geosounding Principles, I. Resistivity Sounding Measurements, Elsevier
 228 Scientific Publishing Comp., Amsterdam, pp275.
- 229 **Ocan, T. (1991):** Petrogenesis of the rock units of Idanre, Southwestern Nigeria. Unpublished
 230 PhD thesis, Obafemi Awolowo University, Ile Ife, Nigeria, pp 194.
- 231 **Olorunfemi etal, (2004):** Geoelectric/Electromagnetic VLF Survey for groundwater
 232 development in basement terrain. A Case Study of Ile-Ife, Ife Journal of Science Vol. 6,No 1.
- 233 **Omosuyi, G. O., Adekoke, A. O., and Adelusi, A. O. (2008):** Interpretation of electromagnetic
 234 and geoelectric sounding data for Groundwater resources around Obanla-Obakekere in Akure
 235 Area within Basement complex of southwestern Nigeria; Pacific Journal of Science and Tech.
 236 Vol. 9 no 2, 509-524.
- 237 **Omosuyi, G. O. (2010):** Geoelectric Assessment of Groundwater prospect and vulnerability of
 238 overburden Aquifer at Idanre, southwestern Nigeria. Ozean Journal of Applied Sciences 3(1).
- 239 **Orellana, E. and Mooney, H. M., (1966):** Master Tables and curves for Vertical Electrical
 240 Soundings over layered structure, intercentia, Madrid.

- 241 **Rahaman, M.A (1988):** Recent advances in the study of the Basement Complex of Nigeria.
242 Precambrian Geology of Nigeria, A Publication of Geological Survey of Nigeria. pp11-41
243 **Rahaman,M. A. (1976):** A review of the Basement Geology of south-western Nigeria. In:
244 Kogbe, C.A., (edited) Geology of Nigeria, Elizabethan publishing, Lagos. 41-58.
- 245 **Vander Velpen, B.P.A (1988):** Resist Version 1.0, M.sc Research Project, Delft, Netherlands.